





HOMEPAGE

PRODUCTS ~

NEWS

DOWNLOAD

ORDERING

SUPPORT ✓

SERVICES ~

ABOUT US

CONTACT

PDATES - BATCORDER 3.X ONLY

You are here: Home » Products » Hardware » batcorder » Updates – batcorder 3.x only

TABLE OF CONTENTS



Please use appropriate batcorder firmware according to your batcorders 1, 2 or 3.

Using other firmware versions – for example 3xx with batcorder 2.0 – can destroy your hardware beyond repair!

DOWNLOAD

MD5 hash of the file UPDAT331.bin: 08e0a1aa08161f0f71f7e76dc1ae9b90

batcorder 3.0/3.1 -Update to SW 331

CHANGES - BATCORDER 3.X ONLY

Find changes, additions etc through firmware updates

Inhalt:

- 1. Changes SW 321
- 2. Changes SW 320
- 3. Changes SW 319
- 4. Changes SW318
- 5. Changes SW317
- 6. Changes SW316
- 7. Changes SW314
- 8. Changes SW313 9. Changes SW312
- 10. Changes SW 323
- 11. Changes SW 325
- 12. Changes SW 326
- 13. Changes SW 328
- 14. Changes SW 329
- 15. Changes SW 331

Changes SW 321

Correct display of stop-time in scanning mode

Changes SW 320

Fixed Logfile now has timestamp of last change

SMS in box mode now always contains most current battery voltage

Internal battery charging and empty battery screen now both show battery voltage Add

When using box mode cut-off voltage was reduced to 4V

Modes auto and auto+timer now display battery voltage when connected to an extension

Changes SW 319

Deleting a card in the batcorder and immediate start of timer mode lead to the batcorder asking to format again and starting sampling.

Fixed Ending the timer manually (REC key) and staying in the timer settings when the original start time was reached crash

the batcorder

Fixed Activating the timer (REC key) before the actual timer start the batcorder crashed when start time was reached.

Changes SW318

Update The 'system volume information' generated by Windows 10 is recognized. The card doesn't have to be formatted.

Update Logfiles from other batcorder revisions are now recognized and the card needs to be formatted.

When used with extensions: If the batcorder shuts down due to low battery (box extension), the timer state is written and the state of the batcorder shuts down due to low battery (box extension), the timer state is written as the batcorder shuts down due to low battery (box extension), the timer state is written as the batcorder shuts down due to low battery (box extension), the timer state is written as the batcorder shuts down due to low battery (box extension), the timer state is written as the batcorder shuts down due to low battery (box extension), the timer state is written as the batcorder shuts down due to low battery (box extension), the timer state is written as the battery (box extension).

correctly to the logfile. If the battery is missing when using the wte, the logfile is written accordingly.

Fixed Various smaller bug fixes

Changes SW317

Fixed Correct display of charging status (internal battery)

Add Changing modes does omit sd card checks to speed up interface

Changes SW316

New entries regarding timer activation in logfile

Interface changes analoge to GSM-batcorder

Fixed Improved handling of SD cards formatted with Windows 10 or OS X 10.12+

Update Improved charging behaviour of the internal Lilonen-battery

Add Better roaming behaviour with Box/WKA 2.0 running SW2.05 or newer

Changes SW314

ed Resolved a communication problem with some extension boxes

Fixed Resolved when timer didn't start after a first start

Changes SW313

Fixed SMS from WKA/Box are not missing their ends anymore

ixed Correct response per SMS if no battery is connected to the WTG extension

Fixed SMS sending is canceled after nine tries

Add Missing battery at WTG extension is now added to the logfile as entry

Changes SW312

Fixed Correct display of recording counts above 65535 in SMS

Add SMS contains battery voltage in SMS

Add Battery voltage displayed in logfile

Add Simulation of stop time using >-key

Add Notice when turning on if timer is active

Changes SW 323

Add Recognition of SD-card errors in the FAT-table and possible direct fix

Add Logfile entry when reading TSL measurements

Add Logfile entry if timer is stopped manually

Add compatibility with extension 4.0 (4G)

Changes SW 325

Update Handling of defective SD cards improved

Update Battery empty messages in logfile

Changes SW 326

Update Smaller improvements

Changes SW 328

Add Various improvements

Changes SW 329

Fixed Some SIM cards didn't respond on first try and resulted in an error.

Changes SW 331

Fixed batcorder with extension stops in settings menu if no network is found

ecoObs GmbH
Hermann-Kolb-Str. 35b
90475 Nürnberg

HARDWARE	SOFTWARE	SUPPORT
BATCORDER GSM-BATCORDER WIND TURBINE EXTENSION	BCADMIN BCANALYZE BATIDENT	Orders +49 911 3768053
BOX-EXTENSION MINI-BATCORDER MAST-MICROPHONE	SERVICES	Software / usage +49 251 96195095 (14 to 17 german time)
BATLURE BATCOUNTER	CALL ANALYSIS CONSULTING CUSTOM SOFTWARE TRAINING TALKS	Hardware +49 911 3768054

SPECIAL TECHNICAL SOLUTIONS

© 2009 - 2025 - ecoObs GmbH - All rights reserved.

CONTACT IMPRINT TERMS OF SERVICE PRIVACY POLICY SITE!